



The installation kit contains a registration card, TT-2200 device, four well nuts, and four socket cap screws.

Additional tools and supplies that you may need include a fine-tip marker, cordless drill, 1/4 in. (7 mm) drill bit, Phillips-head screw driver, 7/64 in. (2.78 mm) hex key, and a ladder.

**Note.** Covert Installation: Though the device may report accurately in covertly installed locations, we do not recommend this type of installation due to the potential for lost data and/or diminished battery life.

## **Installation Steps**

The following steps provide an overview of the installation process:

- 1. Install preparation.
- 2. Mounting.
- 3. Verify the installation.

## **1. Install preparation**

1. Complete the registration card by locating the eight-digit serial number on the bottom of the device and copying the last seven digits onto the card.







- 2. Identify an area horizontal to the ground, that has an unobstructed 180° view of the sky, is not a removable panel and will not be damaged during normal operation of the asset.
- 3. Inspect the area directly underneath the mounting location to ensure nothing will be damaged when drilling.







4. Using a Phillips-head screw driver, remove both screws and panel located at the end of the device, switch the device to ON, then screw the panel back in place.




## 2. Mounting.

Locate the TT-2200 device, fine-tip marker, four well nuts, four socket cap screws, 7/64 in. (2.78 mm) hex key, cordless drill, and 1/4 in. (7 mm) drill bit.

- A. Position the mounting bracket and mark the position of the four holes.
- B. Set the device aside and drill the four holes.
- C. Insert a well nut into each hole.
- D. Using the socket cap screws, secure the device to the asset.





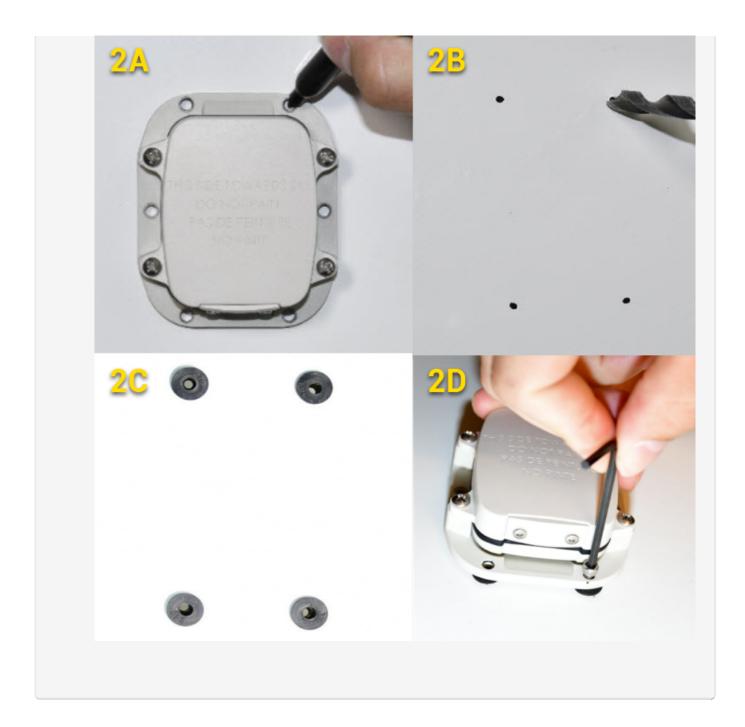

## 3. Verify the installation.

Open the web app: Verify GPS on your computer or smartphone, enter the following information and follow the prompts to register the device.

- 1. Enter your Install Key.
- 2. Enter the Device Serial Number.
- 3. Select Device Type: TT-2200





4. Click 'Next' and follow prompts to register the device

**Note.** It can take between 4-8 hours for the device to report its first point.